



Defect Listing

Pipe Segment Refere... A27-10_A27-9	City Oliver Springs	Street Spring St.	Material Concrete Pipe (non-...	Location C... Light High...	Sewer Use Sanitary
Upstream MH A27-10	Total Length 324.2	Year Laid	Shape Circular	Location Details	
DS Manhole A27-9	Length surveyed 324.2	Year Renewed	Height 8	Width 8	Pipe Joint... 4


SPR	N/A	MPR	4	PO Number 4397-03	Customer GRW
SPRI	N/A	MPRI	2	Work Order 4397-02	Purpose Pre-Rehabilitation Survey
QSR	N/A	QMR	2200		
OPR 4	Surveyed By Charlie Gordon	Direction Downstream	Date 20150902	Media label	
OPRI 2	Certificate Number U-615-07000491	Pre-Cleaning No Pre-Cleaning	Time 08:51	Weather Dry	
	Date Cleaned		End Time 09:16	Additional Info DOWNSTREAM MANHOLEI..	

Distance	Condition	Cont. Dfct.	Values			Joint	Clock Position		Grade
			1st	2nd	%		At/From	To	
0.0 ft.	Access Point Manhole				0	☐			
Remarks: A27-10									
0.0 ft.	Water Level				5	☐			
161.5 ft.	Water Level Sag	S01			10	☐			2
165.9 ft.	Water Level Sag	F01			10	☐			2
165.9 ft.	Water Level				5	☐			
166.8 ft.	Tap Factory Made		6		0	☒	3		
247.5 ft.	Tap Factory Made		6		0	☒	9		
290.1 ft.	Tap Factory Made		6		0	☒	9		
306.1 ft.	Tap Factory Made Active		6		0	☒	3		
318.5 ft.	Water Level Sag	S02			20	☐			2
323.4 ft.	Water Level Sag	F02			20	☐			2
324.2 ft.	Access Point Manhole				0	☐			
Remarks: A27-9									



Image Report 4/Page

Pipe Segment Refere... A27-10_A27-9	City Oliver Springs	Street Spring St.	Material Concrete Pipe (non-...		Location C... Light High...	Sewer Use Sanitary
Upstream MH A27-10	Total Length 324.2	Year Laid	Shape Circular		Location Details	
DS Manhole A27-9	Length surveyed 324.2	Year Renewed	Height 8	Width 8	Pipe Joint... 4	

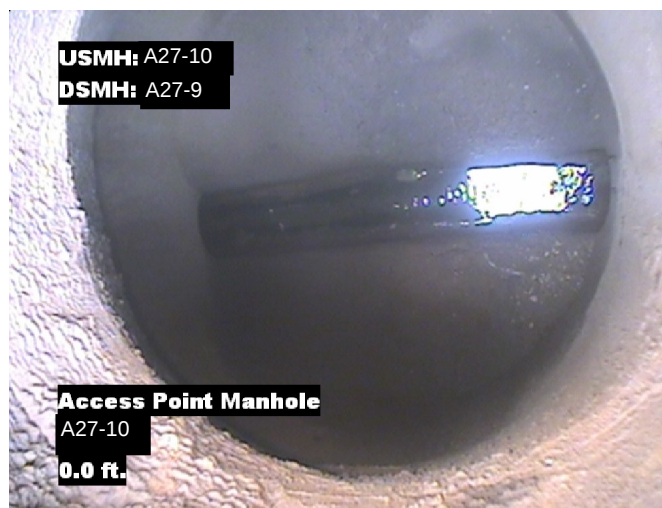

Distance: 0.0 ft. Grade: 0
Condition: Access Point Manhole
Remarks: A27-10



Distance: 0.0 ft. Grade: 0
Condition: Water Level
Remarks: N/A



Distance: 161.5 ft. Grade: 2
Condition: Water Level Sag
Remarks: N/A



Distance: 165.9 ft. Grade: 2
Condition: Water Level Sag
Remarks: N/A



Image Report 4/Page

Pipe Segment Refere... A27-10_A27-9	City Oliver Springs	Street Spring St.	Material Concrete Pipe (non-...		Location C... Light High...	Sewer Use Sanitary
Upstream MH A27-10	Total Length 324.2	Year Laid	Shape Circular		Location Details	
DS Manhole A27-9	Length surveyed 324.2	Year Renewed	Height 8	Width 8	Pipe Joint... 4	




Distance: 165.9 ft. Grade: 0
Condition: Water Level
Remarks: N/A



Distance: 166.8 ft. Grade: 0
Condition: Tap Factory Made
Remarks: N/A



Distance: 247.5 ft. Grade: 0
Condition: Tap Factory Made
Remarks: N/A

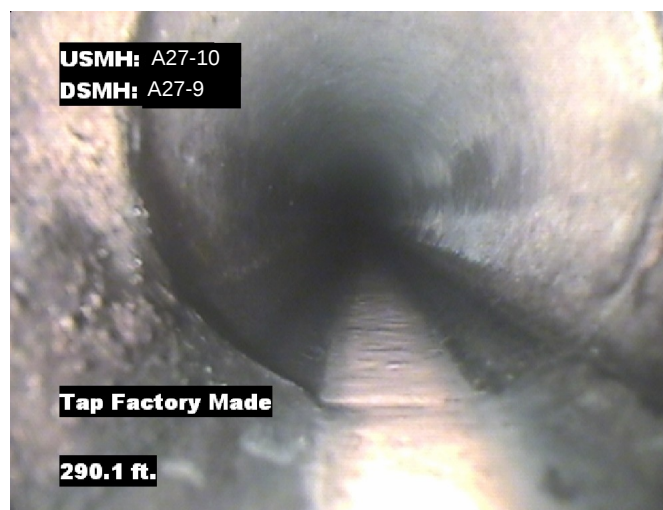

Distance: 290.1 ft. Grade: 0
Condition: Tap Factory Made
Remarks: N/A

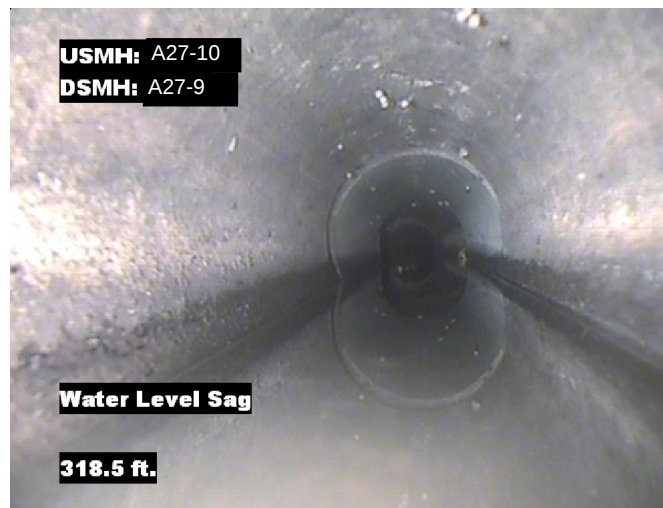


Image Report 4/Page

Pipe Segment Refere... A27-10_A27-9	City Oliver Springs	Street Spring St.	Material Concrete Pipe (non-...		Location C... Light High...	Sewer Use Sanitary
Upstream MH A27-10	Total Length 324.2	Year Laid	Shape Circular		Location Details	
DS Manhole A27-9	Length surveyed 324.2	Year Renewed	Height 8	Width 8	Pipe Joint... 4	



Distance: 306.1 ft. Grade: 0
Condition: Tap Factory Made Active
Remarks: N/A




Distance: 318.5 ft. Grade: 2
Condition: Water Level Sag
Remarks: N/A



Distance: 323.4 ft. Grade: 2
Condition: Water Level Sag
Remarks: N/A



Distance: 324.2 ft. Grade: 0
Condition: Access Point Manhole
Remarks: A27-6

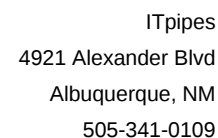

Albuquerque, NM

SPR	N/A	MPR	4	PO Number 4397-03		Customer	
SPRI	N/A	MPRI	2			GRW	
QSR	N/A	QMR	2200	Work Order 4397-02		Purpose	
			Pre-Rehabilitation Survey				
OPR 4		Surveyed By Charlie_Gordon		Direction Downstream	Date 20150902		Media label
OPRI 2		Certificate Number U-615-07000491		Pre-Cleaning No Pre-Cleaning	Time 08:51		Weather Dry
Date Cleaned					End Time 09:16		Additional Info DOWNSTREAM MANHOLE.

Page 1 of 1