



Defect Listing

Pipe Segment Refere... D3-2_D3-1	City Oliver Springs	Street Highway 62	Material Concrete Pipe (non-...	Location C... Easement/R...	Sewer Use Sanitary
Upstream MH D3-2	Total Length 224.9	Year Laid	Shape Circular	Location Details	
DS Manhole D3-1	Length surveyed 224.9	Year Renewed	Height 8	Width 8	Pipe Joint... 4

SPR	N/A	MPR	5	PO Number 4397-03	Customer GRW
SPRI	N/A	MPRI	5	Work Order 4397-02	Purpose Pre-Rehabilitation Survey
QSR	N/A	QMR	5100		
OPR 5	Surveyed By Barry_Rogers	Direction Downstream	Date 20150708	Media label	
OPRI 5	Certificate Number U-1012-16405	Pre-Cleaning Jetting	Time 09:09	Weather Damp	
	Date Cleaned 20150708		End Time 09:24	Additional Info	

Distance	Condition	Cont. Dfct.	Values			Joint	Clock Position		Grade
			1st	2nd	%		At/From	To	
0.0 ft.	Access Point Manhole				0	<input type="checkbox"/>			
Remarks: D3-2									
0.0 ft.	Water Level				10	<input type="checkbox"/>			
29.5 ft.	Tap Factory Made Active		4		0	<input type="checkbox"/>	9		
65.4 ft.	Infiltration Gusher				0	<input type="checkbox"/>	7		5
66.1 ft.	Tap Factory Made		6		0	<input type="checkbox"/>	9		
222.9 ft.	Water Level				10	<input type="checkbox"/>			
224.9 ft.	Access Point Manhole				0	<input type="checkbox"/>			
Remarks: D3-1									

Image Report 4/Page


Pipe Segment Refere... D3-2_D3-1	City Oliver Springs	Street Highway 62	Material Concrete Pipe (non-...	Location C... Easement/R...	Sewer Use Sanitary
Upstream MH D3-2	Total Length 224.9	Year Laid	Shape Circular	Location Details	
DS Manhole D3-1	Length surveyed 224.9	Year Renewed	Height 8	Width 8	Pipe Joint... 4



USMH: D3-2
DSMH: D3-1

Access Point Manhole
D3-2
0.0 ft.


Distance: 0.0 ft. Grade: 0
 Condition: Access Point Manhole
 Remarks: D3-2

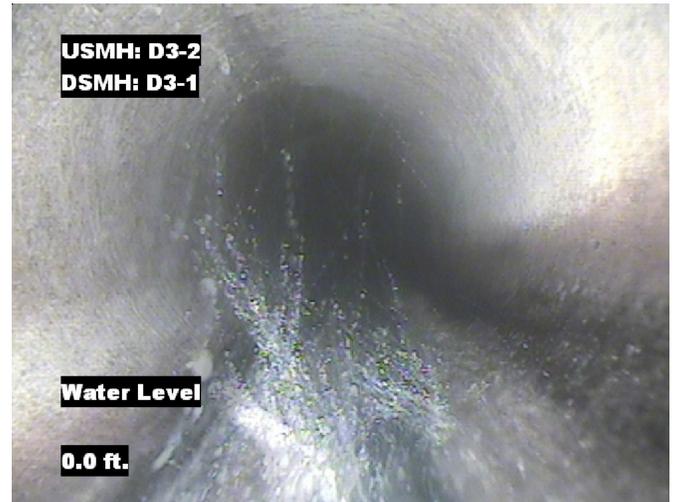

USMH: D3-2
DSMH: D3-1

Water Level
0.0 ft.


Distance: 0.0 ft. Grade: 0
 Condition: Water Level
 Remarks: N/A

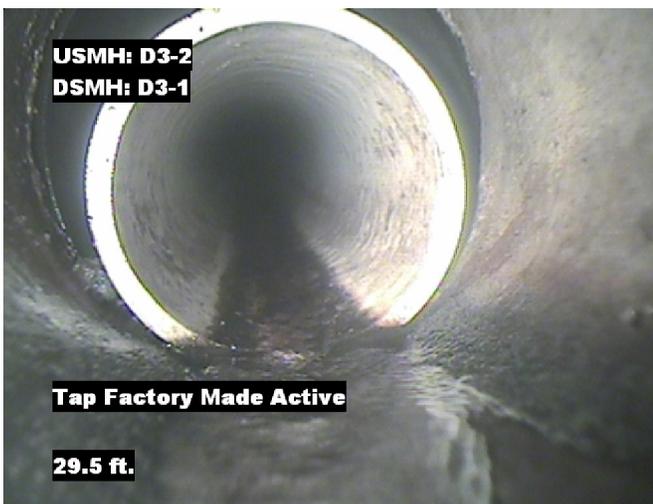

USMH: D3-2
DSMH: D3-1

Tap Factory Made Active
29.5 ft.

Distance: 29.5 ft. Grade: 0
 Condition: Tap Factory Made Active
 Remarks: N/A

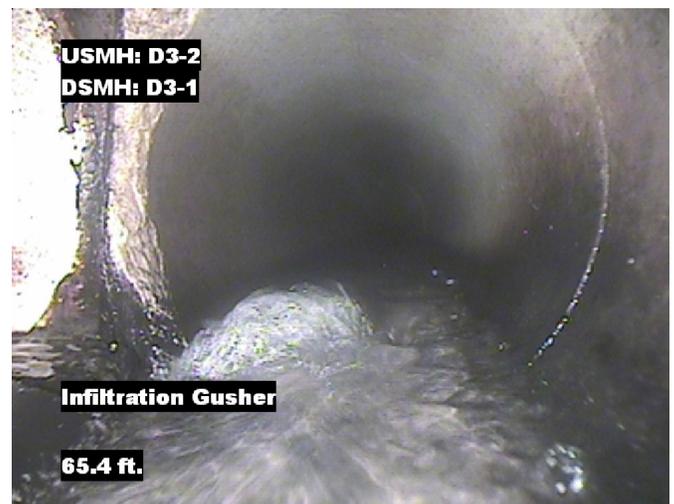

USMH: D3-2
DSMH: D3-1


Infiltration Gusher
65.4 ft.

Distance: 65.4 ft. Grade: 5
 Condition: Infiltration Gusher
 Remarks: N/A



Image Report 4/Page

Pipe Segment Refere... D3-2_D3-1	City Oliver Springs	Street Highway 62	Material Concrete Pipe (non-...	Location C... Easement/R...	Sewer Use Sanitary
Upstream MH D3-2	Total Length 224.9	Year Laid	Shape Circular	Location Details	
DS Manhole D3-1	Length surveyed 224.9	Year Renewed	Height 8	Width 8	Pipe Joint... 4

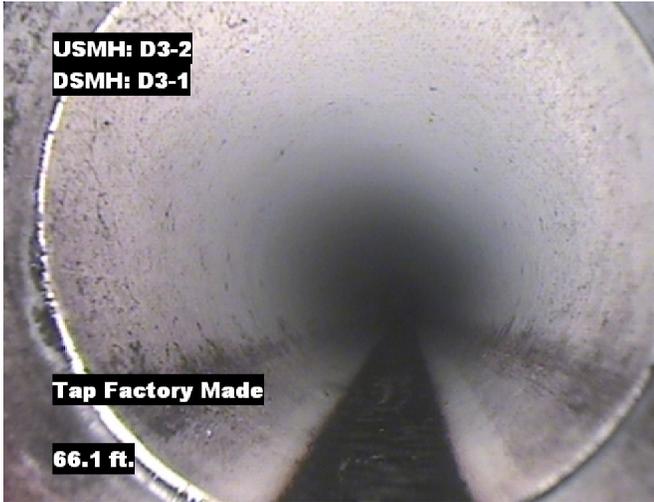

Distance: 66.1 ft. Grade: 0
 Condition: Tap Factory Made
 Remarks: N/A



Distance: 222.9 ft. Grade: 0
 Condition: Water Level
 Remarks: N/A



Distance: 224.9 ft. Grade: 0
 Condition: Access Point Manhole
 Remarks: D3-1

